



# Preliminary Information

## PIP5828 SES Light - DTC P205B Reductant Tank Temperature Sensor Performance

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade models	2021 - 2022	All	All	LM2	All
Chevrolet	Suburban models	2021 - 2022	All	All	LM2	All
Chevrolet	Tahoe models	2021 - 2022	All	All	LM2	All
GMC	Yukon models	2021 - 2022	All	All	LM2	All

Involved Region or Country:	North America
Condition:	Some customers may comment on Service Engine Soon (SES) Lamp being illuminated and/or "Service Emissions System" message on the Driver Information Center (DIC). Technicians may find DTC P205B set active or in history.
Cause:	This is caused by a software anomaly in the Reductant Control Module and replacing the Emission Reduction Fluid Tank, Harness and/or Control Module is not necessary.

### Correction:

If you encounter a vehicle set with DTC P205B currently active (displaying the "Service Emission System" message and SES Lamp illuminated) or in history (SES Lamp illuminated or not illuminated):

1. Perform a Reductant System Tamper Service Bay Test
2. Clear DTCs
  - a. If all ok, return vehicle back to the customer
  - b. If the Service Engine Soon (SES) Lamp is illuminated and/or "Service Emissions System" message is displayed on the Driver Information Center (DIC), follow the appropriate SI procedure

GM Engineering is working on a Service Calibration solution. When this calibration is released this PI will be deleted and a bulletin will be published.

### Version History

Version	1
Modified	11/22/2021 - Created on.



GENERAL MOTORS